



Lutron RadioRA 2 main repeater – Upgrading repeaters affected by the 12.4 firmware update issue

Scope

This process applies to RadioRA 2 main repeaters that are unable to be firmware upgraded and have a date code in the following list:

5C2	0D5
0D1	0D6
0D2	0D7
0D3	0D8
0D4	

Firmware Upgrade Process

1. Power down the main repeater
2. While the main repeater is powered down, hold the “Test” and “Add” buttons on the front of the unit
3. While continuing to hold these buttons, power on the main repeater
4. Continue to hold the “Test” and “Add” buttons until the 5 status LEDs on the front of the repeater are flashing green
5. Open the RadioRA 2 software version 12.6
6. Upgrade the repeaters from the software following the normal procedure

